Rowe, Maynard

SUBMIT THE FOLLOWING COMPLETED FORM TO YOUR LOCAL PLUMBING INSPECTOR

DATE 9/24/73
NUMBER OF BEDROOMS 1
SIZE OF SEPTIC TANK 750 gals
TYPE OF SOIL Charlton Fine Sandy Loam

OWNER Maynard Rowe
STREET Bolton Hill Rd
CITY Augusta MAINE
TEL. NUMBER —

Test Performed by [signature] PE# 1576

Local Plumbing Inspector's Signature George L. Smith

LOCATION OF PROPOSED INSTALLATION
STREET Bolton Hill Rd
CITY Augusta MAINE
TEL. NUMBER

SKETCH: LOCATION OF BUILDING DISPOSAL SYSTEM, TERRAIN FEATURES, PERCOLATION HOLES, WATER SUPPLIES, ETC.

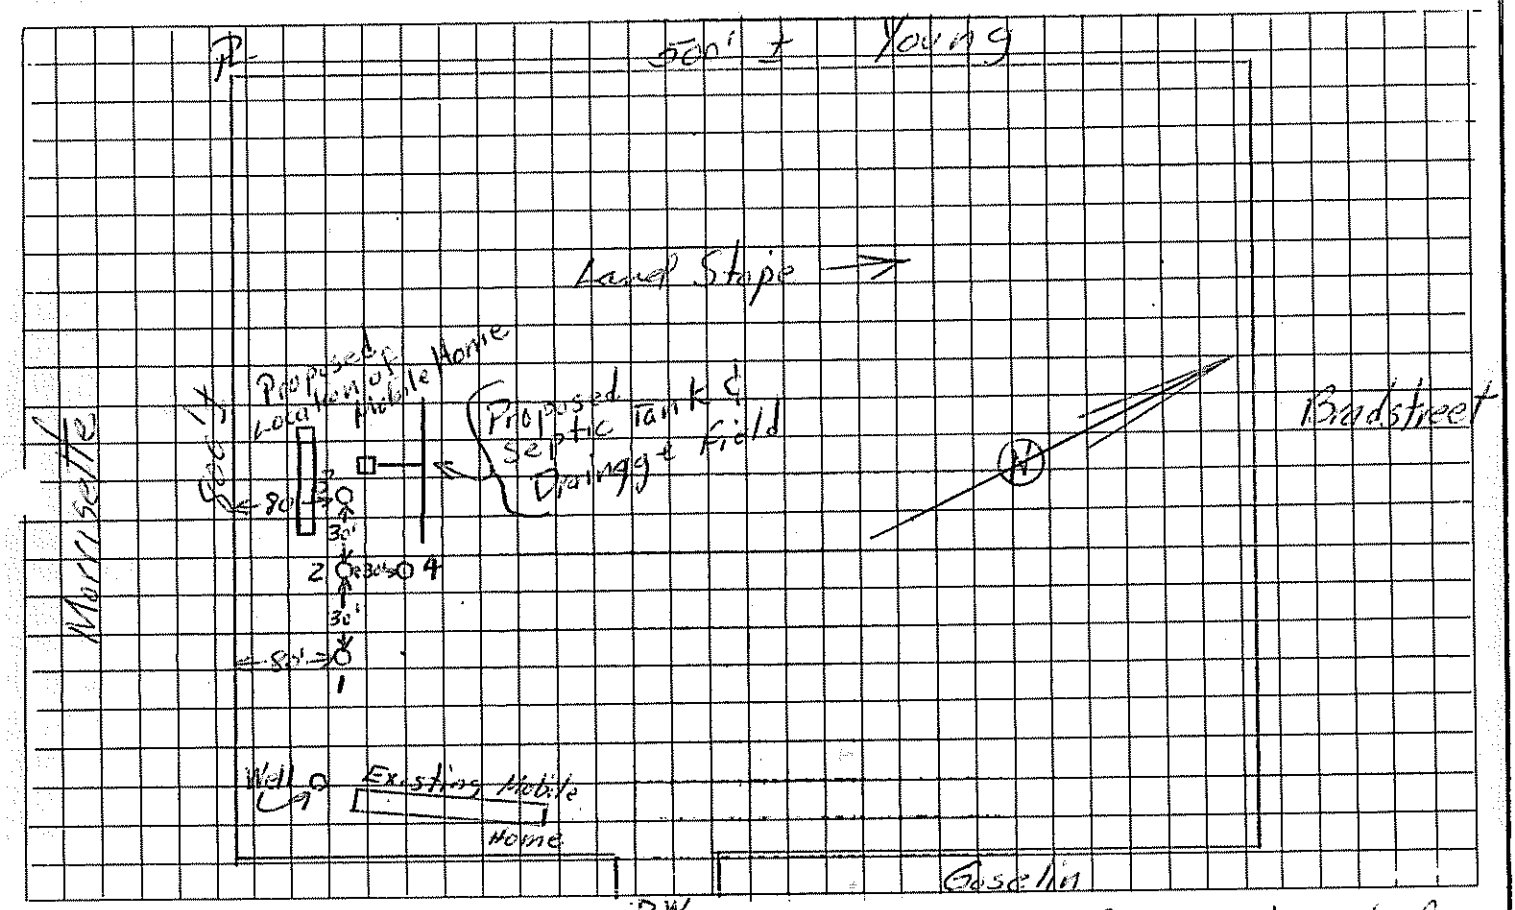

5'+ Depth to Water Table
5'+ Depth to Bedrock
5'+ Depth to Clay or other impervious strata

REMARKS Recomend 85' of Absorption Trench as Shown

HOLE	HOLE DEPTH	TIME START	TIME FINISH	DEPTH OF WATER SURFACE START	DEPTH OF WATER SURFACE FINISH	ELAPSED TIME	TOTAL DROP OF WATER	PERCOL. RATE MINUTES/INCH
#1	36 in.	5:43	6:21	18 in.	21½ in.	38 min.	35 in.	10.9 min/in
#2	36 in.	5:44	6.01	19 in.	23 in.	17 min.	4 in.	4.1 min/in
#3	36 in.	5:45	6:15	19 in.	23¼ in.	30 min.	4.25 in.	7.1 min/in
#4	36 in.	5:45	6:00	19¾ in.	24½ in.	15 min.	4.75 in.	3.2 min/in
						AVERAGE RATE		6.3 min/in