SUBMIT THE FOLLOWING COMPLETED FORM TO YOUR LOCAL PLUMBING INSPECTOR

DATE June 7, 1973
NUMBER OF BEDROOMS 3
SIZE OF SEPTIC TANK 1000 gal
TYPE OF SOIL Sandy Loam

Test Performed by [illegible] P.E. 1576

Local Plumbing Inspector's Signature George L. Abbott

OWNER ~~Madeline Thibeau~~ Rene Rodrigue-Contractor
STREET RFD 3
CITY Augusta MAINE
TEL. NUMBER 622-6174

LOCATION OF PROPOSED INSTALLATION
STREET Lot #3 Grove Development
CITY Middle Rd. Augusta MAINE
TEL. NUMBER

SKETCH: LOCATION OF BUILDING DISPOSAL SYSTEM, TERRAIN FEATURES, PERCOLATION HOLES, WATER SUPPLIES, ETC.

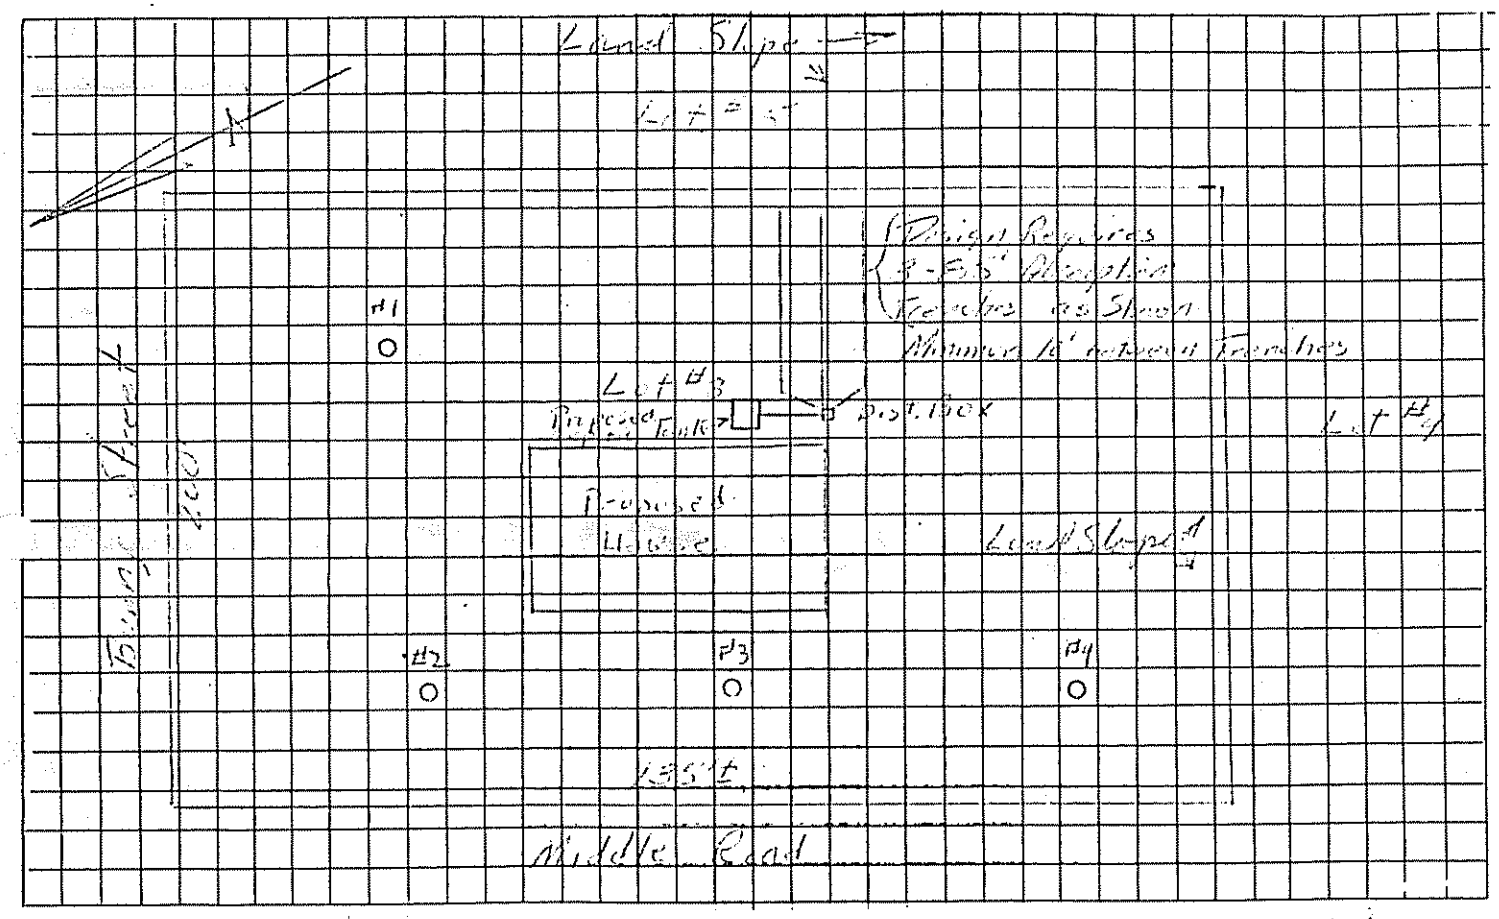

5'± Depth to Water Table
15.25' Depth to Bedrock
10'± Depth to Clay or other impervious strata

REMARKS Well To be Located on Middle Road Frontage with Septic System on backside of Lot as shown

HOLE	HOLE DEPTH	TIME START	TIME FINISH	DEPTH OF WATER SURFACE START	DEPTH OF WATER SURFACE FINISH	ELAPSED TIME	TOTAL DROP OF WATER	PERCOL. RATE MINUTES/INCH
#1	36 in.	5:29	7:23	8 in.	12 in.	113 min.	4 in.	28 min/in
#2	36 in.	5:47	7:07	18 in.	22 in.	80 min.	4 in.	20 min/in
#3	36 in.	5:32	7:08	13 in.	17 in.	76 min.	4 in.	24 min/in
#4	36 in.	5:35	7:10	16½ in.	20½ in.	95 min.	4 in.	23 min/in
						AVERAGE RATE		24 min/in