Larochelle D.

SUBMIT THE FOLLOWING COMPLETED FORM TO YOUR LOCAL PLUMBING INSPECTOR

DATE 9/13/73
NUMBER OF BEDROOMS 3
SIZE OF SEPTIC TANK 1000
TYPE OF SOIL Hartland Sandy Loam
Test Performed by [illegible] PE #1576
Local Plumbing Inspector's Signature George L. Smith

OWNER D. Larochelle
STREET 631 Riverside Dr.
CITY Augusta MAINE
TEL. NUMBER 21053

LOCATION OF PROPOSED INSTALLATION
STREET Patrick
CITY Augusta MAINE
TEL. NUMBER

SKETCH: LOCATION OF BUILDING DISPOSAL SYSTEM, TERRAIN FEATURES, PERCOLATION HOLES, WATER SUPPLIES, ETC.

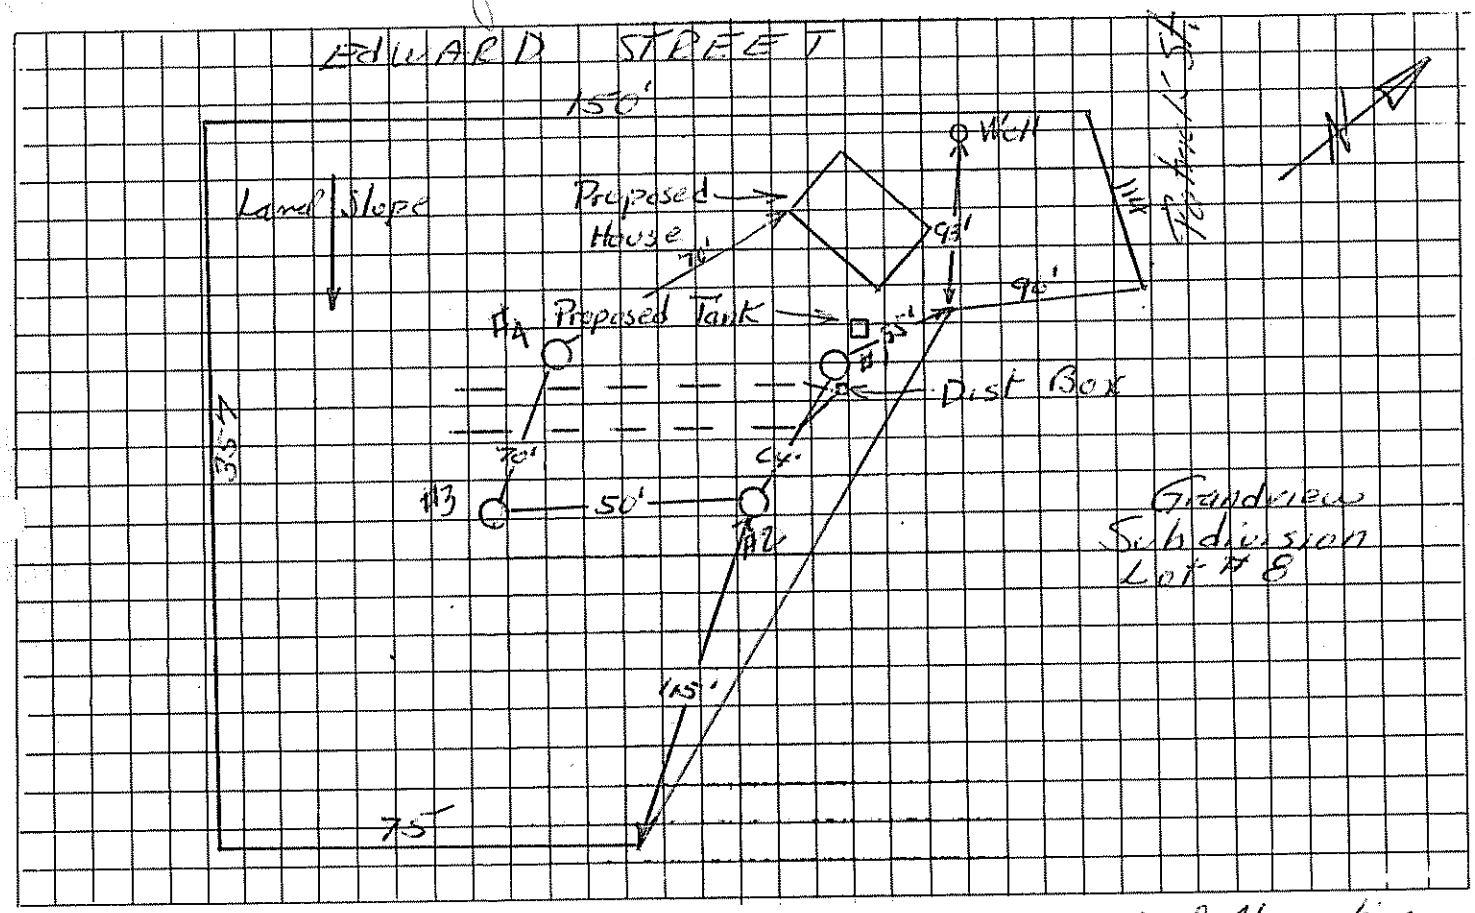

54 Depth to Water Table
80± Depth to Bedrock
54 Depth to Clay or other impervious strata

REMARKS 100' of Absorption Trench needed. Recommend 2-50' Lines as Shown

HOLE	HOLE DEPTH	TIME START	TIME FINISH	DEPTH OF WATER SURFACE START	DEPTH OF WATER SURFACE FINISH	ELAPSED TIME	TOTAL DROP OF WATER	PERCOL. RATE MINUTES/INCH
#1	36 in.	4:49	5:08	16¼ in.	23 in.	19 min.	6¾ in.	3.4 min/in
#2	36 in.	4:51	5:11	15½ in.	24 in.	20 min.	8½ in.	4.3 min/in
#3	36 in.	4:53	5:10	19½ in.	24 in.	18 min.	4½ in.	4.5 min/in
#4	36 in.	4:52	5:09	16 in.	28 in.	17 min.	12 in.	1.4 min/in
						AVERAGE RATE		3.4 min/in